

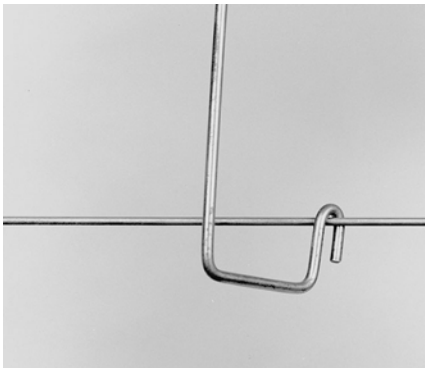


2003-2005 Lincoln Aviator Lockout Guide



This is an alternate procedure for the 2003-05 Lincoln Aviator, 2002-05 Ford Explorer, except Sport and Sport-Trac models, and the 2002-05 Mercury Mountaineer. The procedure found on Ford-15 of the 2005 AAA/CAA Lockout Service for the 2003-05 Lincoln Aviator has caused some lockout technicians difficulty so this alternate procedure has been developed. This procedure will also work on the Aviator's sister vehicles the 2002-05 Ford Explorer and 2002-05 Mercury Mountaineer.

MAKE/MODEL	TOOL				
2002-05 Ford Explorer except Sport and Sport-Trac models 2003-05 Lincoln Aviator 2002 -05 Mercury Mountaineer					
LINKAGE					
Horizontal Rod Forward					
<p>Opening Instructions:</p> <ol style="list-style-type: none"> Using 1 or 2 wedges, carefully open a ¼ inch gap between the glass and sill weatherstrip just forward of the quarter glass post on the right rear door. Use a light probe to identify the linkage and any wiring or components to be avoided. Enter the tool with the tip facing forward and the shaft 2 inches forward of the quarter glass post. Lower the tool through into the door cavity 4 inches then turn the tip of the tool to face straight inward at 12 o'clock. Continue lowering the tool, approximately 8 more inches, until contact is made with the lock rod. Bind the tool on the rod by turning the top of the tool counter clockwise then slide the tool forward to unlock the vehicle. <p>Clean the glass and all surfaces in the entry area before leaving the vehicle.</p> <p>CAUTION: Do not use excessive force. If the rod binds, pivot the tool against your thumb at the sill edge to gain leverage.</p>					

FORD 15 AND 21 ALTERNATE PROCEDURE